Release Notes

NCP Secure Enterprise VPN Server

for Windows

Major release: 14.00 r32190
Date: December 2025

Prerequisites

Operating System
The following Microsoft Operating Systems are supported with this release:

- Windows Server 2025
- Windows Server 2022

Prerequisites for NCP Secure Enterprise VPN Server (SES)

The following versions are required for the use of other NCP components:

- Secure Enterprise Management Server version 8.10 or higher
- Management Console version 8.00 or higher
- Management Plug-in Server Configuration Version 14.00 or higher
- Secure Enterprise HA Server version 14.00 or higher

1. New features and enhancements

Maintenance mode

Maintenance mode offers a simple option for removing one or more VPN gateways from productive operation. This means that no incoming connections are accepted at the affected gateways, allowing updates or other work to be carried out at a later date. Maintenance mode must then be deactivated again.

Server certificate distribution

A server certificate imported into the server plug-in can be distributed to managed gateways via the NCP Secure Enterprise Management Server from version 8.0 onwards.

2. Improvements / Problems Resolved

Update to OpenSSL 3.5 and update of other open source libraries

The OpenSSL version used in SES has been upgraded to version 3.5. In addition, the open source libraries contained in SES have been updated. The respective versions can be found in the document “OpenSourceLicenseTerms.pdf”.

Troubleshooting: “Forward SEM requests” option has no effect

The “Domain group”/‘Forwarding’/“Forward SEM requests” option had no effect. The problem has

been fixed.

DNS server is not transferred via DHCP

If a DHCP server was configured in a domain group and the configuration for the DNS servers was omitted, the DNS servers distributed via DHCP were not transferred to the clients, or only one of them was transferred. This problem has been fixed.

Incorrect certificate request in the WebGUI

The request for a certificate via WebGUI within the server certificate configuration was incorrect. This problem has been fixed.

Troubleshooting: Crash of a remote site gateway when dialing into the head office

Due to an incorrect VRRP configuration, the backup gateway at a remote site incorrectly attempted to establish a connection to the head office. This caused the backup gateway to crash. The problem that led to the crash has been fixed.

Disabling IPv6 on the NCP adapter

As with the other network adapters, IPv6 can also be disabled for the NCP network adapter starting with this server version.

Error when selecting the server certificate

If multiple server certificates are configured in a domain group, under certain circumstances, the certificate selected by the administrator was not used for authentication with the client. This issue has been resolved.

Connection to the NCP Secure Enterprise Management Server

The programs `rsuinit.exe` and `rsuinitha.exe` have been supplemented with error messages for cases where a generated configuration cannot be saved.

Remote SES sporadically unavailable during Site2Site connection

In a Site2Site scenario, a remote SES establishes a connection to the central SES. In rare cases, every IP address in the remote network can be accessed from the central side, but the remote SES itself cannot. This issue has been resolved.

RIP unicast only to one master router

The SES offers up to four configurable master routers as recipients of a RIP unicast. However, only the first one was addressed. This problem has been fixed.

Troubleshooting: DDNS update packet with incorrect source IP address

Protect LAN adapters

If the “Protect LAN adapters” option was enabled, no data exchange via IPv6 was possible on the relevant network interface. This problem has been fixed.

Server plug-in - DH groups added

The IPsec options for the IKE DH and PFS group entries have been supplemented with groups 27-30.

3. Known Issues

Entered license is only applied after restart

In the event of an update from a licensed SES version 13.x, the SES must be restarted after importing the current license version 14. This also applies to license entry after a new installation in the event of an expired trial period.

Combination of client certificate with ECC and SES with RSA does not work

If certificates with Elliptic Curve Cryptography (ECC) are used on the client and an RSA server certificate is configured on the SES, no connection can be established. The following error message appears on the client:

```
ERROR - 4036: Auth - PKI ERROR: - <> Verify Server certificate with error
2107! (Ext. ‘SSL Server Authentication’ failed)
```

This problem will be fixed in a future version of the gateway with the configuration option for the RFC7427 padding method.

4. Getting Help for the NCP Secure Enterprise VPN Server

To ensure that you always have the latest information about the NCP Secure Enterprise VPN Server, always check the NCP website at:

https://www.ncp-e.com/en/products/centrally-managed-vpn-solution/gateway

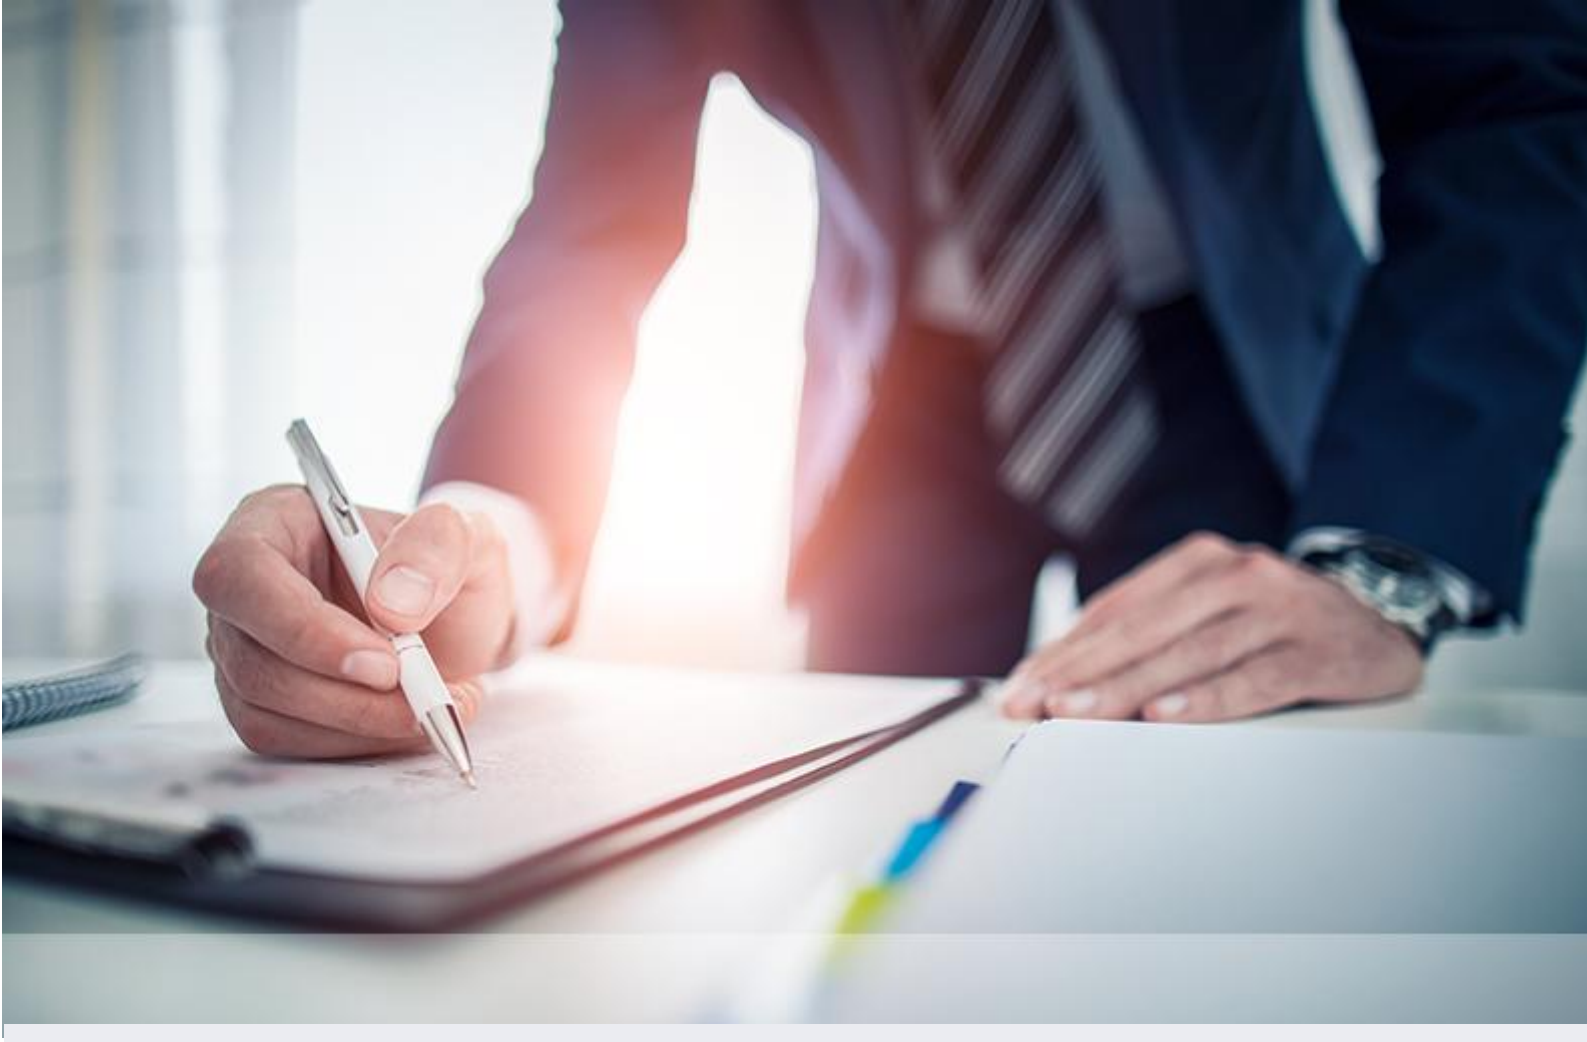

NCP engineering GmbH
Dombuehler Str. 2
90449 Nuremberg
Deutschland

+49 911 9968 0
info@ncp-e.com
www.ncp-e.com

NCP engineering, Inc.
19321 US Highway 19 N, Suite 401
Clearwater, FL 33764
USA

+1 650 316 6273
info@ncp-e.com
www.ncp-e.com